

SuperUpgrade User Guide

1. Connect scanner
 - 1.1 RS232 COM Port
 - 1.2 USB COM Port

Step 1 Scan




Step 2 Install driver (Depending on your operating system)


You must install Supermax - Virtual COM Driver on (windows XP,windows 7,windows 8,windows 8.1).

You do not need install Supermax - Virtual COM Drive on windows 10.

2. Install, and then open SuperUpgrade.
3. Configure the Com port which scanner is connected (use USB COM Port or RS232 COM Port), open the firmware file (*.sm), and then Click "Download" to start firmware upgrade process.

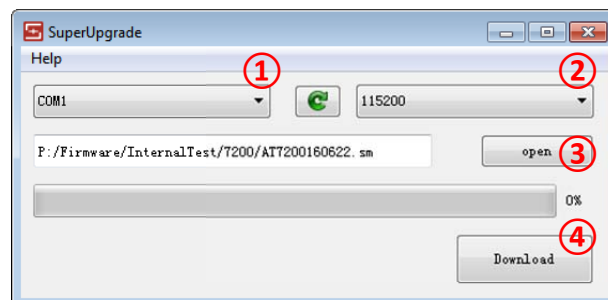

4. Firmware upgrade is processing.

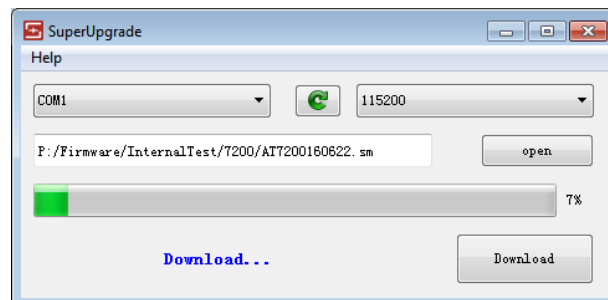

5. After display "OK", firmware upgrade is done, you can close the SuperUpgrade tool.

